HD 2107.1, HD 2107.2, HD 2127.1, HD 2127.2

HD2107.1, HD2107.2, HD2127.1 E HD2127.2
THERMOMETERS SENSORS: Pt100, Pt1000

HD2107.1 and l'HD2107.2 are portable instruments equipped with large LCD display fitted with one input. **HD2127.1 and HD2127.2** are instruments fitted with two inputs. They measure temperature by means of immersion, penetration, contact or air probes. Their sensor can be Pt100 with 3 or 4 wires, Pt1000 with 2 wires. They have centesimal resolution in the range ± 199.99°C, decimal in the rest of the range.

Probes are equipped with an automatic recognition module: factory calibration data are stored inside.

The instruments HD2107.2 and HD2127.2 are **data loggers**; they store up to 80.000 samples which can be transferred into a PC connected to the instrument through the serial ports RS232C and USB 2.0. It is possible to configure the storage interval, the printing and the baud rate by the menu.

All models are equipped with RS232C serial port and are able to transfer the acquired measures, in real time, to a PC or a portable printer.

Functions Max, Min and Avg calculate maximum, minimum and average values.

Further functions are: REL relative measure, HOLD and automatic switching-off system, excludable.

Instruments have IP66 protection degree.

HD2107

HD2127

TECHNICAL SPECIFICATIONS OF THE INSTRUMENTS

Instrument

Dimensions	
(Length x Width x Height)	185x90x40mm
Weight	470g (complete with batteries)
Materials	ABS, rubber
Display	2x4½ digits plus symbols
	Visible area: 52x42mm

Operating conditions

Operating temperature	-5 … 50°C
Storage temperature	-25 … 65°C
Working relative humidity	0 … 90% RH, no condensation
Protection degree	**IP66**

Power supply

Batteries	4 Batteries 1.5V type AA
Autonomy	200 hours with 1800mAh alkaline batteries
Current consumption with instrument off	20µA
Main	12Vdc / 1000mA Output main adapter

Unit of measurement — °C - °F - °K

Security of stored data — Unlimited, independent of battery charge conditions

Time

Date and time	In real time
Accuracy	1min/month max drift

Measured values storage
model **HD2107.2**

Type	2000 pages containing 40 samples each
Quantity	Total of 80000 samples
Storage interval can be selected between	1,5,10,15,30 s.; 1,2,5,10,15,20,30 min.;1 hour

model **HD2127.2**

Type	2000 pages containing 16 pairs of samples each
Quantity	Total of 32000 samples (channel A + channel B)
Storage interval can be selected between	1,5,10,15,30 s.; 1,2,5,10,15,20,30 min.;1 hour

Serial interface RS232C

Type	RS232C galvanic isolated
Baud rate	can be set from 1200 to 38400 baud
Data bit	8
Parity	None
Stop bit	1
Flow Control	Xon/Xoff
Serial cable length	Max 15m
Print interval	Immediate or selectable between:
	1,5,10,15,30 s.; 1,2,5,10,15,20,30 min.; 1 hour

*USB interface - model **HD2107.2, HD2127.2***

Type	1.1 - 2.0 galvanic isolated

Connections

Input module for the probes	8-pole male DIN45326 connector
RS232C serial interface	8-pole MiniDin connector
USB interface	Type B MiniUSB connector
Mains adapter	2-pole connector (positive at centre)

Measurement of temperature by Instrument

Pt100 measurement range	-200…+650°C
Pt1000 measurement range	-200…+650°C
Resolution	**0.01°C in the range ±199.99°C**
	0.1°C in the remaining range
Instrument Accuracy	±0.01°C
Drift after 1 year	0.1°C/year

TECHNICAL DATA OF PROBES AND MODULES EQUIPPED WITH INSTRUMENT
Temperature probes Pt100 sensor with SICRAM module

Model	Type	Application field	Accuracy
TP472I	Immersion	-196°C…+500°C	±0.25°C (-196°C…+300°C) ±0.5°C (+300°C…+500°C)
TP472I.0 1/3 DIN Thin Film	Immersion	-50°C…+300°C	±0.25°C (-50°C…+300°C)
TP473P.I	Penetration	-50°C…+400°C	±0.25°C (-50°C…+300°C) ±0.5°C (+300°C…+400°C)
TP473P.0 1/3 DIN Thin Film	Penetration	-50°C…+300°C	±0.25°C (-50°C…+300°C)
TP474C.0 1/3 DIN Thin Film	Contact	-50°C…+300°C	±0.3°C (-50°C…+300°C)
TP475A.0 1/3 DIN Thin Film	Air	-50°C…+250°C	±0.3°C (-50°C…+250°C)
TP472I.5	Penetration	-50°C…+400°C	±0.3°C (-50°C…+300°C) ±0.6°C (+300°C…+400°C)
TP472I.10	Penetration	-50°C…+400°C	±0.30°C (-50°C…+300°C) ±0.6°C (+300°C…+400°C)
TP49A.I Class A Thin Film	Immersion	-70°C…+250°C	±0.3°C (-70°C…-50°C) ±0.25°C (-50°C…+250°C)
TP49AC.I Class A Thin Film	Contact	-70°C…+250°C	±0.3°C (-70°C…-50°C) ±0.25°C (-50°C…+250°C)
TP49AP.I Class A Thin Film	Penetration	-70°C…+250°C	±0.3°C (-70°C…-50°C) ±0.25°C (-50°C…+250°C)
TP875.I	Globe-thermometer Ø150mm	-30°C…+120°C	±0.25°C
TP876.I	Globe-thermometer Ø50mm	-30°C…+120°C	±0.25°C
TP87.0 1/3 DIN Thin Film	Immersion	-50°C…+200°C	±0.25°C
TP878.0 1/3 DIN Thin Film TP878.1.0 1/3 DIN Thin Film	Photovoltaic	-40°C…+85°C	±0.25°C
TP879.0 1/3 DIN Thin Film	Compost	-20°C…+120°C	±0.25°C

Common features
Temperature drift @20°C   0.003%/°C

4 wires Pt100 and 2 wires Pt1000 Probes

Model	Type	Application field	Accuracy
TP47.100.0 1/3 DIN Thin Film	4 wires Pt100	-50…+250°C	1/3 DIN
TP47.1000.0 1/3 DIN Thin Film	2 wires Pt1000	-50…+250°C	1/3 DIN
TP87.100.0 1/3 DIN Thin Film	4 wires Pt100	-50…+200°C	1/3 DIN
TP87.1000.0 1/3 DIN Thin Film	2 wires Pt1000	-50…+200°C	1/3 DIN

Common features
Temperature drift @20°C
Pt100   0.003%/°C
Pt1000   0.005%/°C

A To the portable data loggers of the series **HD21….2** a serial port mini USB type HID (Human Interface Device) has been inserted.
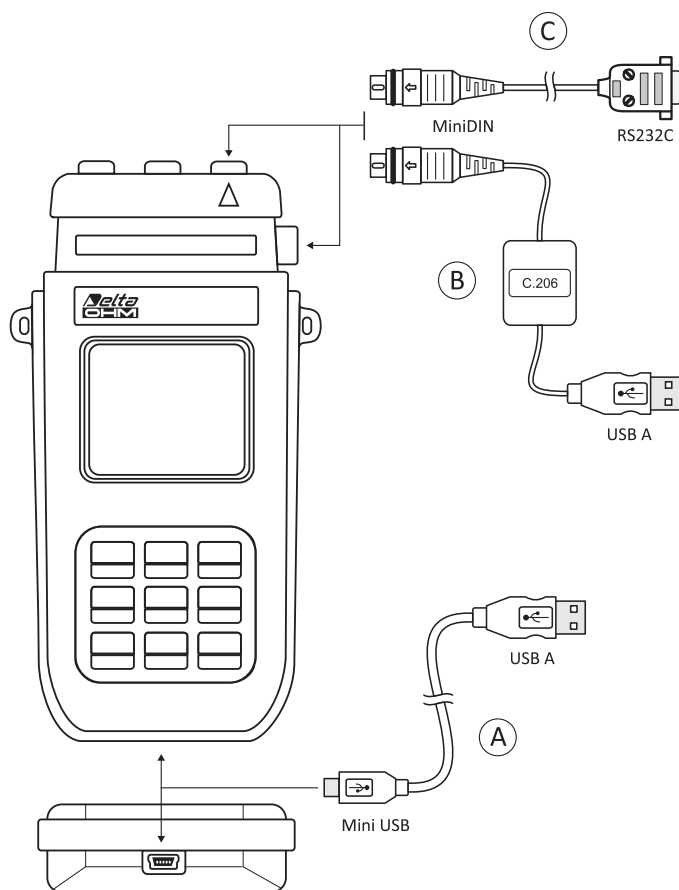

SWD10

HD2110CSNM

For the connection to a PC with the cable USB type A - MiniUSB type B code CP23, **it is not necessary to load any driver USB.**

B For the connection of the models HD21….1 to the USB port of a PC, is necessary the USB/serial **converter C.206**. The converter is supplied with its own drivers which must be installed before the connection of the converter to the PC.(see details in the Cd-Rom supplied with the converter).

C The port with the miniDin connector in all included models, is a serial port type RS232C. The serial port RS232C of a PC or the printer HD40.1 can be connected by the cable HD2110CSNM.

ORDERING CODES

HD2107.1: The kit consists of instrument HD2107.1, 4 per 1.5V alkaline batteries, instruction manual, case and **DeltaLog9 software** downloadable from Delta OHM website. **Probes and cables have to be ordered separately.**

HD2107.2: The kit consists of instrument HD2107.2 **data logger**, 4 per 1.5V alkaline batteries, instruction manual, CP23 USB cable, case and **DeltaLog9 software** downloadable from Delta OHM website. **Probes and cables have to be ordered separately.**

HD2127.1: The kit consists of instrument HD2127.1, 4 per 1.5V alkaline batteries, instruction manual, case and **DeltaLog9 software** downloadable from Delta OHM website. **Probes and cables have to be ordered separately.**

HD2127.2: The kit consists of instrument HD2127.2 **data logger**, 4 per 1.5V alkaline batteries, instruction manual, CP23 USB cable, case and **DeltaLog9 software** downloadable from Delta OHM website. **Probes and cables have to be ordered separately.**

HD2110CSNM: 8-pole connection cable MiniDin - Sub D 9-pole female for RS232C.

C.206: Cable for instruments of the serie HD21…1 to connect directly to USB input of PC.

SWD10: Stabilized power supply at 230Vac/12Vdc-1000mA mains voltage.

HD40.1: Upon request, portable, serial input, 24 column thermal printer, 58mm paper width. Use cable HD2110CSNM (option).

Temperature probes equipped with SICRAM module

TP472I: Immersion probe, Wire Wound Pt100 sensor. Stem Ø 3 mm, length 300 mm. Cable 2 meters long.

TP472I.0: Immersion probe, Thin Film Pt100 sensor. Stem Ø 3 mm, length 230 mm. Cable 2 meters long.

TP473P.I: Penetration probe, Wire Wound Pt100 sensor. Stem Ø 4mm, length 150 mm. Cable 2 meters long.

TP473P.0: Penetration probe, Thin Film Pt100 sensor. Stem Ø 4mm, length 150 mm. Cable 2 meters long.

TP474C.0: Contact probe, Thin Film Pt100 sensor. Stem Ø 4mm, length 230mm, contact surface Ø 5mm. Cable 2 meters long.

TP475A.0: Air probe, Thin Film Pt100 sensor. Stem Ø 4mm, length 230mm. Cable 2 meters long.

TP472I.5: Penetration probe, Thin Film Pt100 sensor. Stem Ø 6mm, length 500 mm. Cable 2 meters long.

TP472I.10: Penetration probe, Thin Film Pt100 sensor. Stem Ø 6mm, length 1000mm. Cable 2 meters long.

TP49A.I: Immersion probe, Thin Film Pt100 sensor. Stem Ø 2.7mm, length 150mm. Cable 2 meters long. Aluminium handle.

TP49AC.I: Contact probe, Thin Film Pt100 sensor. Stem Ø 4 mm, length 150mm. Cable 2 meters long. Aluminium handle.

TP49AP.I: Penetration probe, Thin Film Pt100 sensor. Stem Ø 2.7mm, length 150mm. Cable 2 meters long. Aluminium handle.

TP875.I: Globe thermometer Ø 150 mm with handle. Wire Wound Pt100 sensor complete of SICRAM module. Cable 2 meters long.

TP876.I: Globe thermometer Ø 50 mm with handle. Wire Wound Pt100 sensor complete of SICRAM module. Cable 2 meters long.

TP87.0: Immersion probe, Thin Film Pt100 sensor. Stem Ø 3 mm, length 70 mm. Cable 2 meters long.

TP878.0: Contact probe for solar panels. Thin Film Pt100 sensor. Cable 2 meters long.

TP878.1.0: Contact probe for solar panels. Thin Film Pt100 sensor .Cable 5 meters long

TP879.0: Penetration probe for compost. Thin Film Pt100 sensor. Stem Ø 8 mm, length 1000mm. Cable 2 meters long.

Temperature probes without SICRAM module

TP47.100.0: Immersion probe, Thin Film Pt100 sensor probe. Stem Ø 3 mm, length 230mm. 4 wires connection cable with connector, 2 meters long.

TP47.1000.0: Thin Film Pt1000 sensor immersion probe. Stem Ø 3 mm, length 230mm. 2 wires connection cable with connector, 2 meters long.

TP47: Only connector for probe connection without SICRAM module: direct 3 and 4 wires Pt100, 2 wires Pt1000.

TP87.100.0 Immersion probe, Thin Film Pt100 sensor. Stem Ø 3 mm, length 70mm. Cable 2 meters long. 4 wires connection cable with connector 1 meter long.

TP87.1000.0 Immersion probe, Thin Film Pt100 sensor. Stem Ø 3 mm, length 70mm. Cable 2 meters long. 2 wires connection cable with connector 1 meter long.

TP875.I

HD40.1